

Date: January 2002

Bulletin No: 11 001 02 (002)

BMW Motorcycles

Subject: Slip-ring seal for oil/water pump,

all K 75, K 100, K 1100 models.


Details: All K 75, K 100, and K 1100 now share the same slip-ring seal,

spacer and impeller as the K 1200 RS/LT.

Service Measures:

When making repairs to the oil/water pump, the updated slip ring seal (3) should be used. This updated slip ring **must** be installed in conjuction with updated spacer (2) and sheet metal impeller (1).

Follow installation instructions as outlined in the K 1200 RS Service Manual.

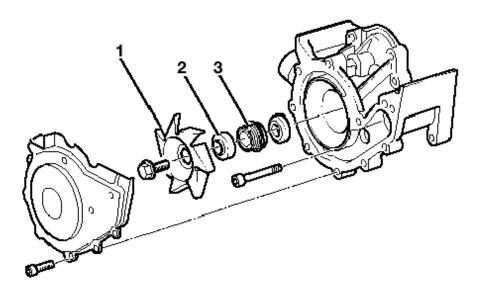

Parts Information:

The updated parts carry the following part numbers.

Metal impeller (rotor): 11 41 1 461 173

Picture reference #1

Spacer: 11 51 1 464 902

Picture reference #2

Slip ring seal: 11 51 1 704 084

Picture reference #3

Important

Use BMW special tool No. 11 6 724 to install the updated slip ring seal. Failure to do so will result in an incorrect seating of the seal. Refer to the K 1200 RS Service Manual for installation instructions.



Bulletin No: 11 001 02 (002) Page 2 of 2

Warranty Not a warrranty issue. This information is supplied to inform retailers of the availability of updated replacement parts.